
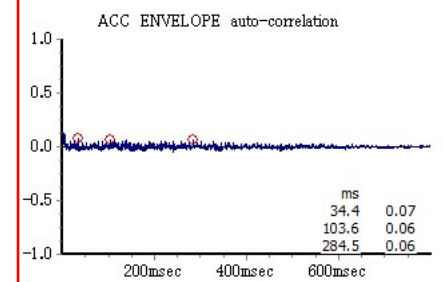
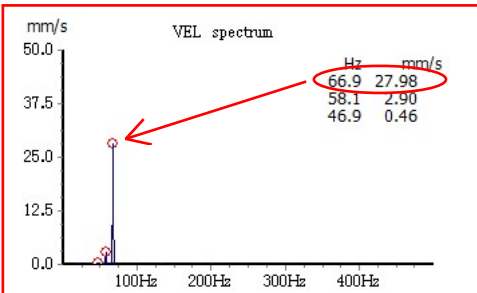
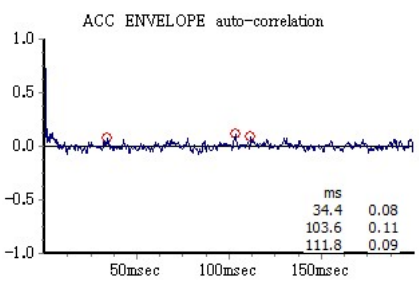
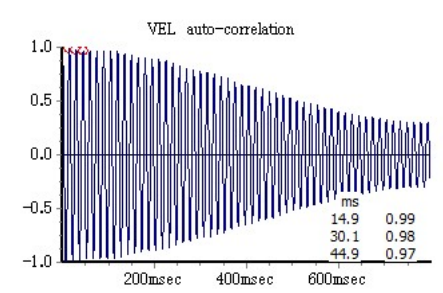
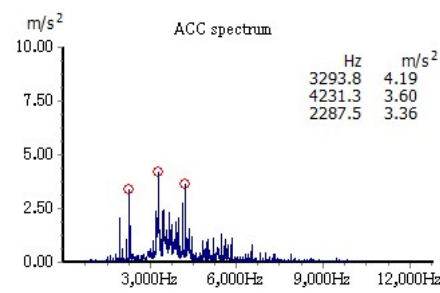
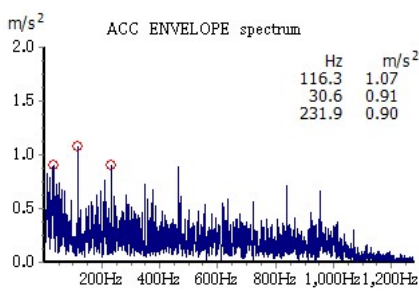
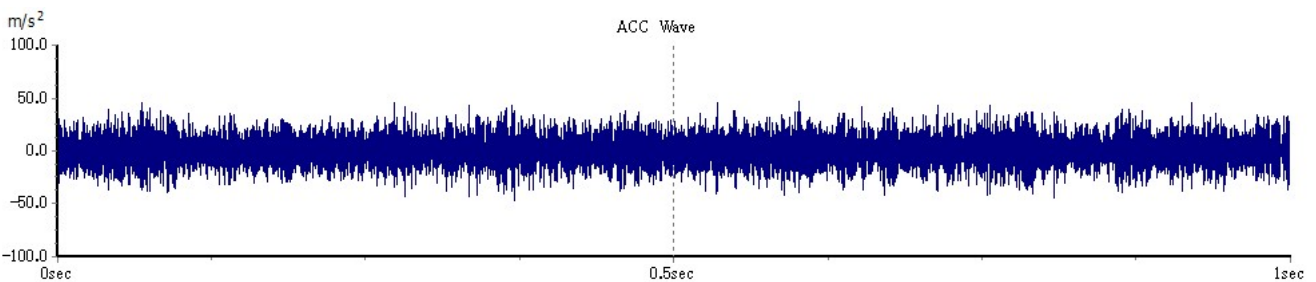
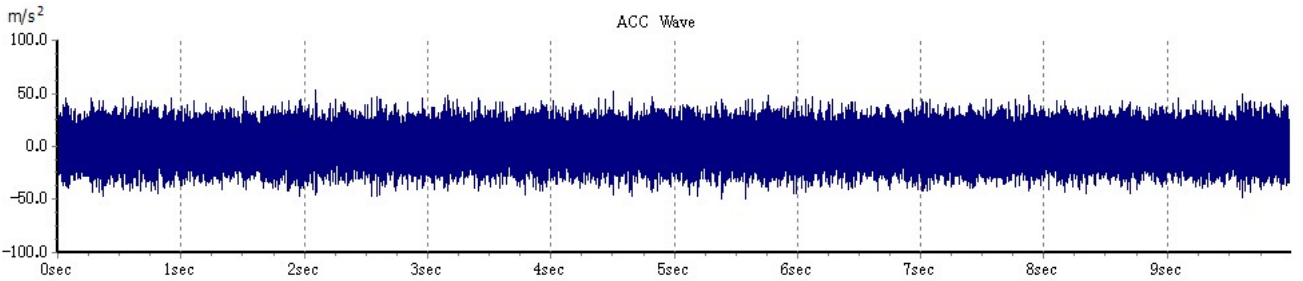
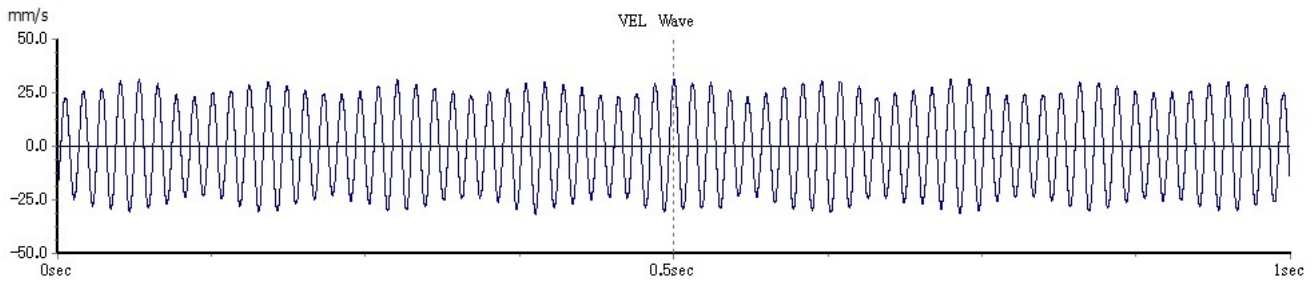


Analysis data
振動診断カルテ

部位/方向 03H
症状/異常原因

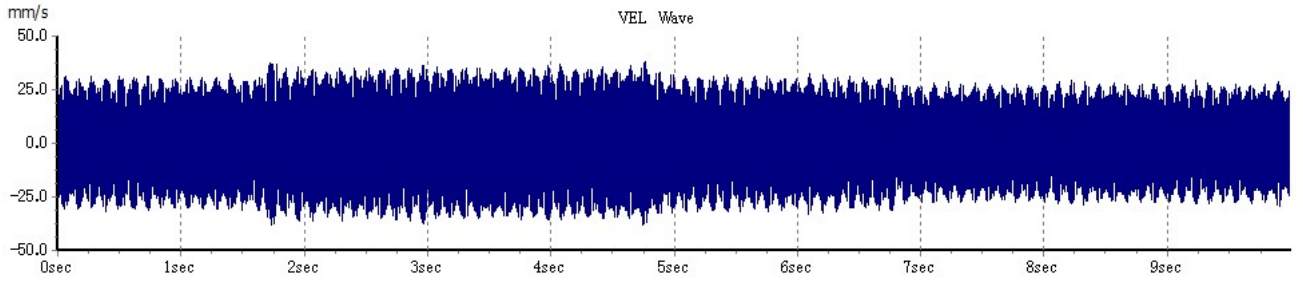

軸受No. 6208C3

諸元計算値

回転 :fr	回転 :2fr	内輪 :fi	外輪 :fo	転動体:fb	転動体:2fb	保持器:fc	Z数成分:fp
58.12 Hz	116.23 Hz	313.44 Hz	209.61 Hz	140.62 Hz	281.24 Hz	23.29 Hz	232.47 Hz
17.21 ms	8.60 ms	3.19 ms	4.77 ms	7.11 ms	3.56 ms	42.94 ms	4.30 ms